



# I. Verifying current version of software is available

<https://youtu.be/2p41wuRxB4Y>


Check that SD card has the most current software version.  
Tap the upper right hand corner to reveal a hidden menu.

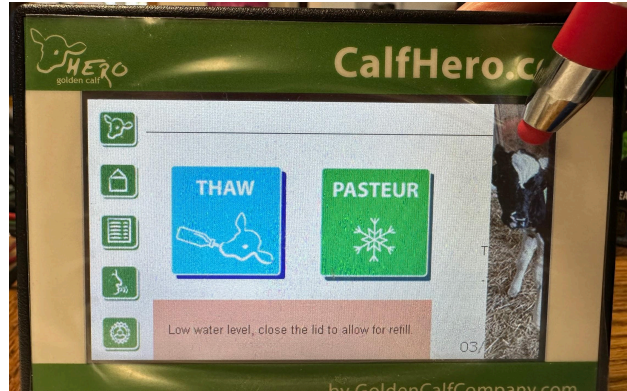

Tap above the calf's head to reveal a systems menu

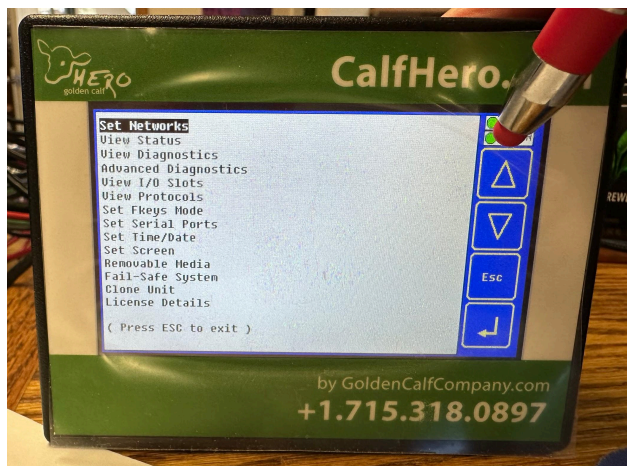


Either tap or use the arrows to go down to Removable Media

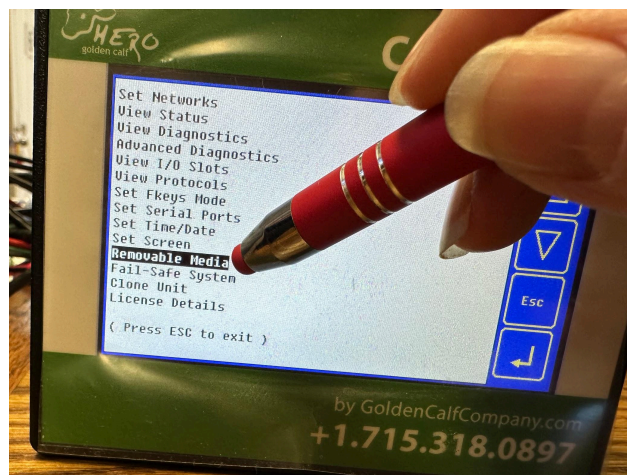


# Golden Calf Company - Calf Hero AutoFill - resetting unit

Press the Return button

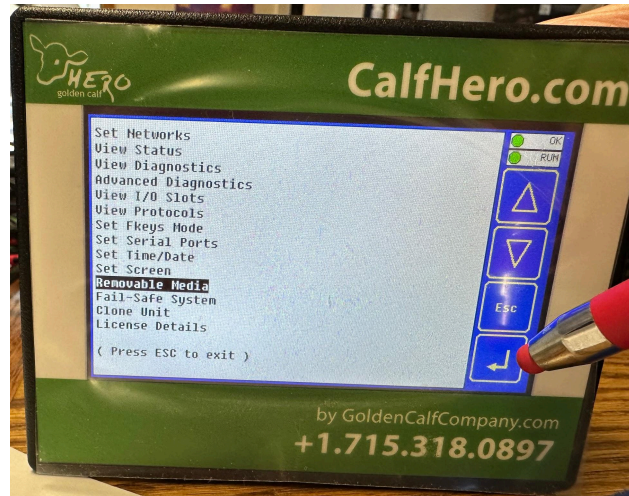

Use the down arrow to check for software presence.

confirm that it contains file named v504\_CHX.pgm  
Scroll to make sure that there are not multiple files with the same starting name, if so, confirm with GCC customer service the most recent file version.

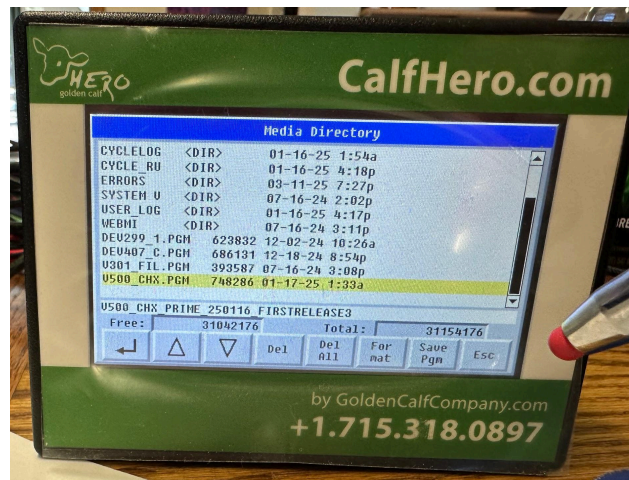

You have now verified that the software is available and you have the correct version. If there is no file matching that name, please contact GCC support.

Escape out of the current screen.  
Hit Escape again to return to the home screen.


## II. Clear out existing application

<https://youtu.be/PHWP18roU8A>


Reveal the hidden menu by tapping the upper right hand corner.



Press and hold the same area above the calf's head for appx 5 seconds or until a blue System's Recovery Screen shows up.

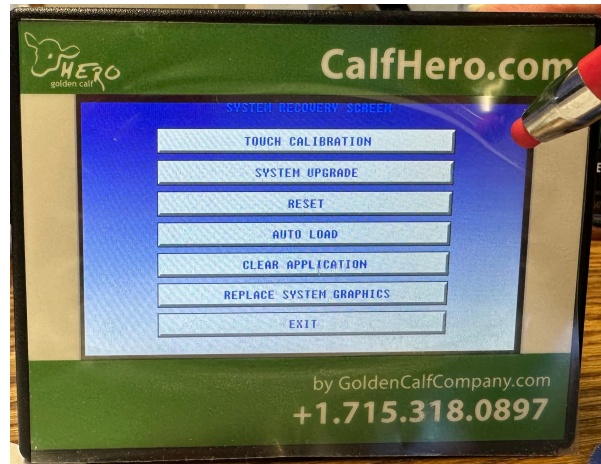


Choose "CLEAR APPLICATION"

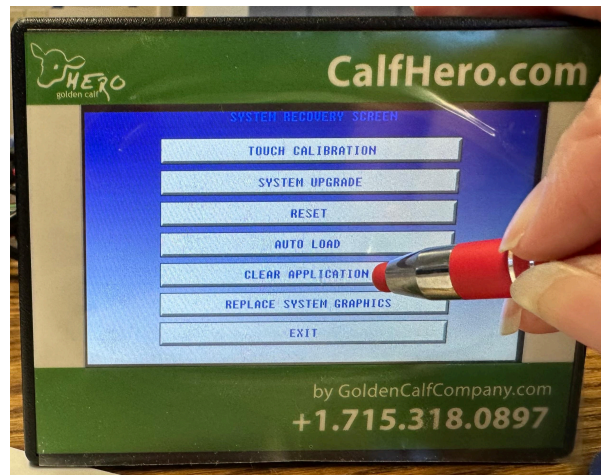

Golden Calf Company - Calf Hero AutoFill - resetting unit


Press ok on the next screen

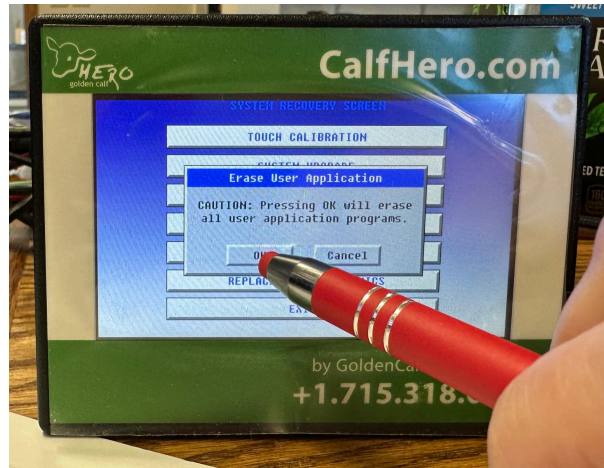

The screen will go black for appx 5 seconds.




A series of runup screens will go through.

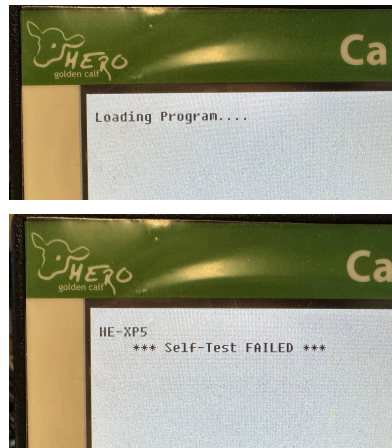


### III. Clearing out memory

- <https://youtu.be/aq9q-pA5qAw>


The final screen will read "NO USER SCREENS TO DISPLAY"  
Tap the upper right hand corner to reveal a hidden menu.  
then press and hold the top menu button until the system recovery screen shows up.

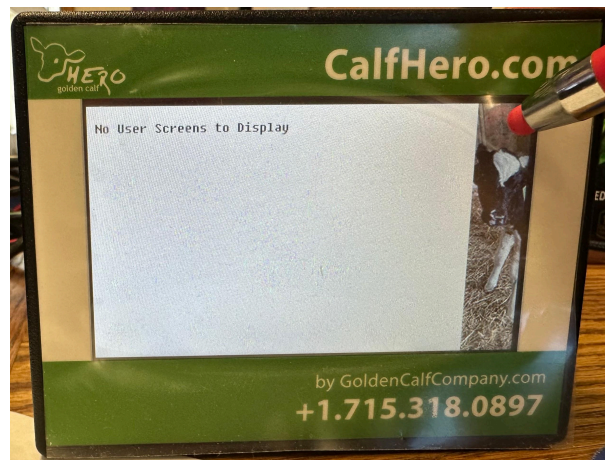

Select the "RESET" button

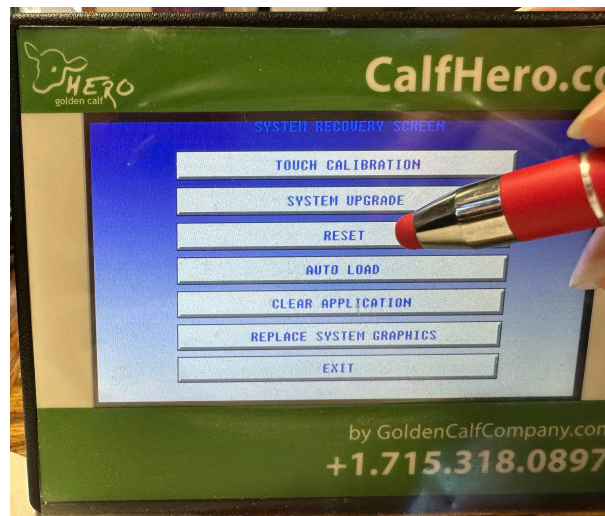


When asked, press the "OK" button  
Next, The screen will go black, Wait through the start-up screens, until the final screen shows up with "NO USER SCREENS TO DISPLAY" message

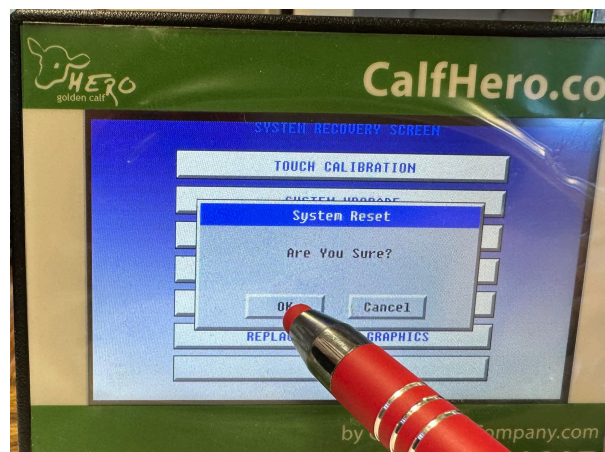


## IV. Loading New Application

<https://youtu.be/UAb2vSxtMEg>


The screen will go black, Wait through the start-up screens, until The final screen shows up with “NO USER SCREENS TO DISPLAY” message

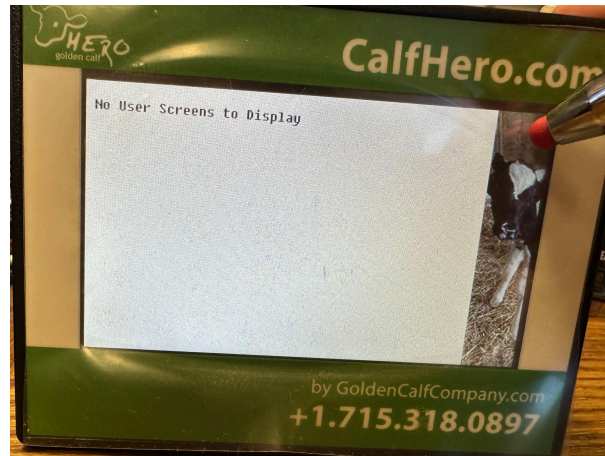

Press to show the hidden menu  
Tap above the calf's head to reveal a systems menu  
Choose the “REMOVABLE MEDIA”.

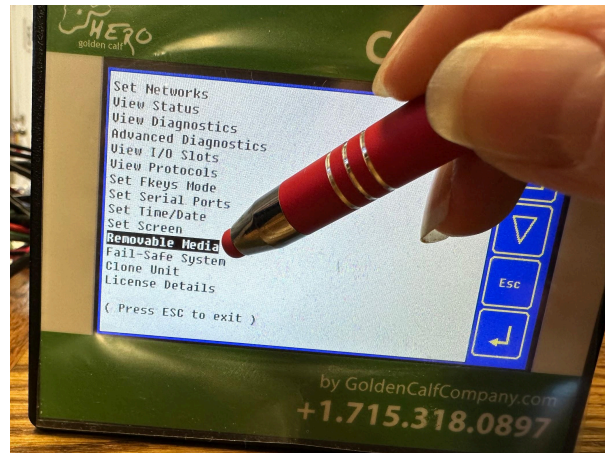

Scroll down to choose the file named v500\_CHX.pgm  
Press “RETURN”

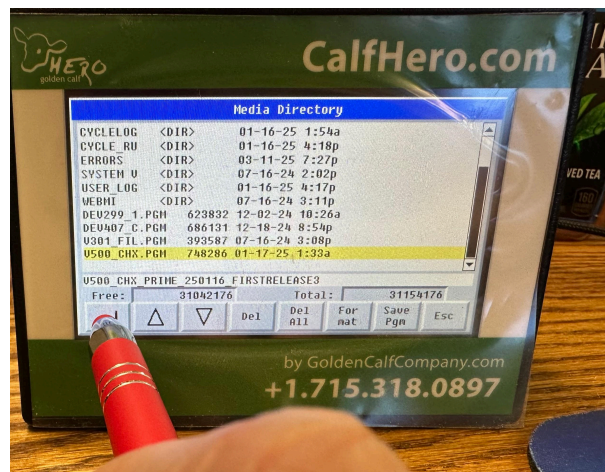


Golden Calf Company - Calf Hero AutoFill - resetting unit

Press the "OK" button




On next screen press "OK"

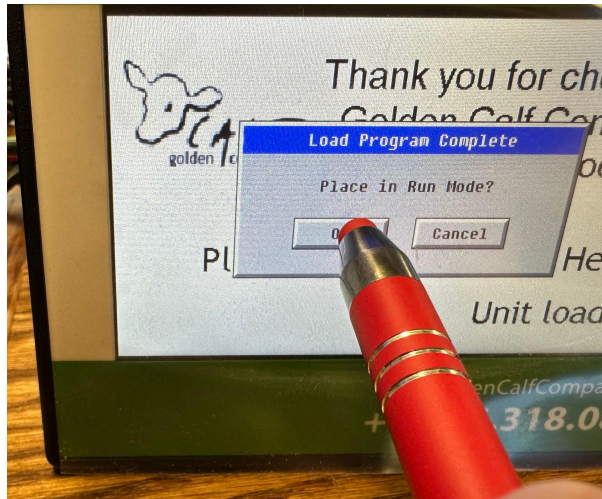

## V. Loading Factory Settings


1. Press the Calf Head button on the left menu
2. Make a note of what Software Rev you are on currently
3. Press the Login button and enter code 5796

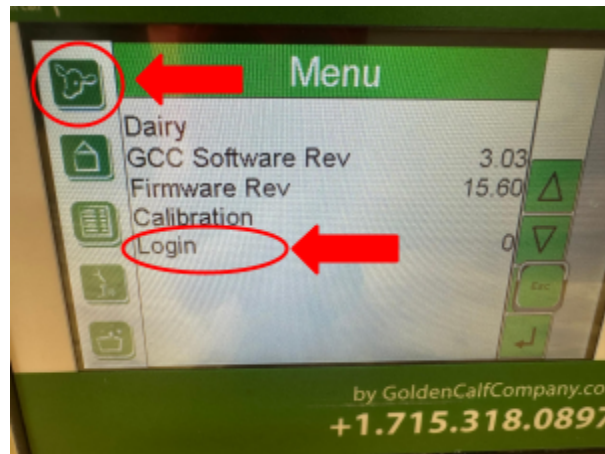

On the next screen, please **fill out all the missing information**

- enter your dairy name
- enter the unit number - last three digits from the serial plate
- enter the voltage - as listed on the serial plate (if the plate lists 208-240, please enter 240)
- enter the phase - as listed on the serial plate

Then press "the bottom right red button" - the screen will not change!

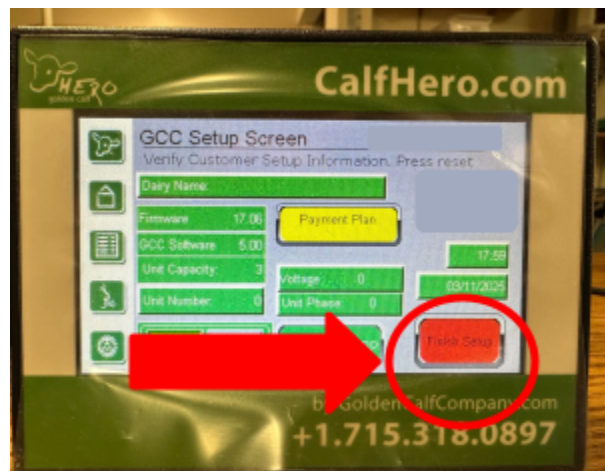

Press the "HOME" button in the left side menu.



The "Welcome" screen should appear  
Press the "START" button